



Virtual GPU Software R450 for Red Hat Enterprise Linux with KVM

Release Notes

Table of Contents

Chapter 1. Release Notes.....	1
1.1. NVIDIA vGPU Software Driver Versions.....	1
1.2. Compatibility Requirements for the NVIDIA vGPU Manager and Guest VM Driver.....	2
1.3. Updates in Release 11.6.....	3
1.4. Updates in Release 11.5.....	3
1.5. Updates in Release 11.4.....	4
1.6. Updates in Release 11.3.....	4
1.7. Updates in Release 11.2.....	4
1.8. Updates in Release 11.1.....	5
1.9. Updates in Release 11.0.....	5
Chapter 2. Validated Platforms.....	7
2.1. Supported NVIDIA GPUs and Validated Server Platforms.....	7
2.2. Hypervisor Software Releases.....	8
2.3. Guest OS Support.....	10
2.3.1. Windows Guest OS Support.....	11
2.3.2. Linux Guest OS Support.....	13
2.4. NVIDIA CUDA Toolkit Version Support.....	16
2.5. Multiple vGPU Support.....	16
2.6. Peer-to-Peer CUDA Transfers over NVLink Support.....	18
2.7. Since 11.1: GPUDirect Technology Support.....	20
Chapter 3. Known Product Limitations.....	21
3.1. Issues occur when the channels allocated to a vGPU are exhausted.....	21
3.2. Virtual GPU hot plugging is not supported.....	22
3.3. Total frame buffer for vGPUs is less than the total frame buffer on the physical GPU....	22
3.4. Issues may occur with graphics-intensive OpenCL applications on vGPU types with limited frame buffer.....	25
3.5. In pass through mode, all GPUs connected to each other through NVLink must be assigned to the same VM.....	25
3.6. vGPU profiles with 512 Mbytes or less of frame buffer support only 1 virtual display head on Windows 10.....	26
3.7. NVENC requires at least 1 Gbyte of frame buffer.....	26
3.8. VM running an incompatible NVIDIA vGPU guest driver fails to initialize vGPU when booted.....	27
3.9. Single vGPU benchmark scores are lower than pass-through GPU.....	28
3.10. nvidia-smi fails to operate when all GPUs are assigned to GPU pass-through mode....	29

Chapter 4. Resolved Issues.....	30
Chapter 5. Known Issues.....	33
5.1. Since 11.6: NVENC does not work with Teradici Cloud Access Software on Windows.....	33
5.2. A licensed client might fail to acquire a license if a proxy is set.....	33
5.3. Session connection fails with four 4K displays and NVENC enabled on a 2Q, 3Q, or 4Q vGPU.....	34
5.4. 11.0-11.3 Only: Rebooting a Windows 10 vGPU VM causes a host crash.....	35
5.5. For some accounted processes, nvidia-smi incorrectly reports maximum memory use of 0 MiB.....	36
5.6. 11.0 Only: Desktop sessions disconnect after the server becomes unresponsive.....	36
5.7. 11.0-11.2 Only: Sessions freeze randomly with XID errors 38, 43, 32, and 31.....	37
5.8. Since 11.1: Idle NVIDIA A100 GPUs show 100% GPU utilization.....	37
5.9. Since 11.1: Guest VM frame buffer listed by nvidia-smi for vGPUs on GPUs that support SRIOV is incorrect.....	38
5.10. VMs fail to boot on RHV 4.4.....	39
5.11. 11.0 Only: Application responsiveness degrades over time.....	40
5.12. 11.0 Only: On systems with more than 1 TiB of system memory, application performance degrades over time.....	41
5.13. 11.1 Only: Licensing event logs indicate license renewal from unavailable primary server.....	41
5.14. 11.0 Only: The NVIDIA license not present notification appears even for VMs for which the vGPU is licensed.....	42
5.15. Driver upgrade in a Linux guest VM with multiple vGPUs might fail.....	46
5.16. 11.0 Only: Failure to allocate resources causes VM failures or crashes.....	47
5.17. NVIDIA Control Panel fails to start if launched too soon from a VM without licensing information.....	47
5.18. 11.0 Only: Remoting solution session freezes with VGPU message 21 failed and VGPU message 14 failed errors.....	48
5.19. On Linux, the frame rate might drop to 1 after several minutes.....	48
5.20. DWM crashes randomly occur in Windows VMs.....	49
5.21. Publisher not verified warning during Windows 7 driver installation.....	50
5.22. RAPIDS cuDF merge fails on NVIDIA vGPU.....	51
5.23. ECC memory settings for a vGPU cannot be changed by using NVIDIA X Server Settings.....	51
5.24. Changes to ECC memory settings for a Linux vGPU VM by nvidia-smi might be ignored.....	52
5.25. Vulkan applications crash in Windows 7 guest VMs configured with NVIDIA vGPU.....	53
5.26. Host core CPU utilization is higher than expected for moderate workloads.....	53
5.27. Frame capture while the interactive logon message is displayed returns blank screen.....	54
5.28. RDS sessions do not use the GPU with some Microsoft Windows Server releases.....	55

5.29. When the scheduling policy is fixed share, GPU utilization is reported as higher than expected.....	55
5.30. License is not acquired in Windows VMs.....	56
5.31. nvidia-smi reports that vGPU migration is supported on all hypervisors.....	57
5.32. Hot plugging and unplugging vCPUs causes a blue-screen crash in Windows VMs.....	58
5.33. Luxmark causes a segmentation fault on an unlicensed Linux client.....	58
5.34. A segmentation fault in DBus code causes nvidia-gridd to exit on Red Hat Enterprise Linux and CentOS.....	59
5.35. No Manage License option available in NVIDIA X Server Settings by default.....	59
5.36. Licenses remain checked out when VMs are forcibly powered off.....	60
5.37. VM bug checks after the guest VM driver for Windows 10 RS2 is installed.....	61
5.38. GNOME Display Manager (GDM) fails to start on Red Hat Enterprise Linux 7.2 and CentOS 7.0.....	62

Chapter 1. Release Notes

These *Release Notes* summarize current status, information on validated platforms, and known issues with NVIDIA vGPU software and associated hardware on Red Hat Enterprise Linux with KVM.



Note: The most current version of the documentation for this release of NVIDIA vGPU software can be found online at [NVIDIA Virtual GPU Software Documentation](#).

1.1. NVIDIA vGPU Software Driver Versions

Each release in this release family of NVIDIA vGPU software includes a specific version of the NVIDIA Virtual GPU Manager, NVIDIA Windows driver, and NVIDIA Linux driver.

NVIDIA vGPU Software Version	NVIDIA Virtual GPU Manager Version	NVIDIA Windows Driver Version	NVIDIA Linux Driver Version
11.6	450.156.00	453.23	450.156.00
11.5	450.142	453.10	450.142.00
11.4	450.124	452.96	450.119.03
11.3	450.102	452.77	450.102.04
11.2	450.89	452.57	450.89
11.1	450.80	452.39	450.80.02
11.0	450.55	451.48	450.51.05

For details of which Red Hat Enterprise Linux with KVM releases are supported, see [Hypervisor Software Releases](#).

1.2. Compatibility Requirements for the NVIDIA vGPU Manager and Guest VM Driver

The releases of the NVIDIA vGPU Manager and guest VM drivers that you install must be compatible. If you install an incompatible guest VM driver release for the release of the vGPU Manager that you are using, the NVIDIA vGPU fails to load.

See [VM running an incompatible NVIDIA vGPU guest driver fails to initialize vGPU when booted](#).



Note: This requirement does not apply to the NVIDIA vGPU software license server. All releases in this release family of NVIDIA vGPU software are compatible with **all** releases of the license server.

Compatible NVIDIA vGPU Manager and Guest VM Driver Releases

The following combinations of NVIDIA vGPU Manager and guest VM driver releases are compatible with each other.

- ▶ NVIDIA vGPU Manager with guest VM drivers from the same release
- ▶ NVIDIA vGPU Manager with guest VM drivers from different releases within the same major release branch
- ▶ NVIDIA vGPU Manager from a later major release branch with guest VM drivers from the previous branch



Note:

When NVIDIA vGPU Manager is used with guest VM drivers from a different release within the same branch or from the previous branch, the combination supports **only** the features, hardware, and software (including guest OSes) that are supported on both releases.

For example, if vGPU Manager from release 11.6 is used with guest drivers from release 10.4, the combination does **not** support Windows 7 because NVIDIA vGPU software release 11.6 does not support Windows 7.

The following table lists the specific software releases that are compatible with the components in the NVIDIA vGPU software 11 major release branch.

NVIDIA vGPU Software Component	Releases	Compatible Software Releases
NVIDIA vGPU Manager	11.0 through 11.6	<ul style="list-style-type: none"> ▶ Guest VM driver releases 11.0 through 11.6 ▶ All guest VM driver 10.x releases

NVIDIA vGPU Software Component	Releases	Compatible Software Releases
Guest VM drivers	11.0 through 11.6	NVIDIA vGPU Manager releases 11.0 through 11.6

Incompatible NVIDIA vGPU Manager and Guest VM Driver Releases

The following combinations of NVIDIA vGPU Manager and guest VM driver releases are incompatible with each other.

- ▶ NVIDIA vGPU Manager from a later major release branch with guest VM drivers from two or more major releases before the release of the vGPU Manager
- ▶ NVIDIA vGPU Manager from an earlier major release branch with guest VM drivers from a later branch

The following table lists the specific software releases that are incompatible with the components in the NVIDIA vGPU software 11 major release branch.

NVIDIA vGPU Software Component	Releases	Incompatible Software Releases
NVIDIA vGPU Manager	11.0 through 11.6	All guest VM driver releases 9.x and earlier
Guest VM drivers	11.0 through 11.6	All NVIDIA vGPU Manager releases 10.x and earlier

1.3. Updates in Release 11.6

New Features in Release 11.6

- ▶ Security updates - see *Security Bulletin: NVIDIA GPU Display Driver - October 2021*, which is posted shortly after the release date of this software and is listed on the [NVIDIA Product Security](#) page
- ▶ Miscellaneous bug fixes

1.4. Updates in Release 11.5

New Features in Release 11.5

- ▶ Security updates - see [Security Bulletin: NVIDIA GPU Display Driver - July 2021](#)
- ▶ Miscellaneous bug fixes

Feature Support Withdrawn in Release 11.5

- ▶ Red Hat Enterprise Linux with KVM hypervisor 8.3 is no longer supported.
- ▶ Red Hat Enterprise Linux 8.3 is no longer supported as a guest OS.

1.5. Updates in Release 11.4

New Features in Release 11.4

- ▶ Security updates - see [Security Bulletin: NVIDIA GPU Display Driver - April 2021](#)
- ▶ Miscellaneous bug fixes

Hardware and Software Support Introduced in Release 11.4

- ▶ Support for Red Hat Enterprise Linux with KVM hypervisor 8.4
- ▶ Support for Red Hat Enterprise Linux 8.4 as a guest OS

1.6. Updates in Release 11.3

New Features in Release 11.3

- ▶ Security updates - see [Security Bulletin: NVIDIA GPU Display Driver - January 2021](#)
- ▶ Miscellaneous bug fixes

Hardware and Software Support Introduced in Release 11.3

- ▶ Support for Red Hat Enterprise Linux with KVM hypervisor 8.3
- ▶ Support for Windows 10 October 2020 Update (20H2) as a guest OS
Windows 10 May 2021 Update (21H1), which is a bug fix release for Windows 10 October 2020 Update (20H2), is also supported.
- ▶ Support for Red Hat Enterprise Linux 8.3 as a guest OS

Feature Support Withdrawn in Release 11.3

- ▶ Citrix Hypervisor 8.1 is no longer supported.
- ▶ Red Hat Enterprise Linux with KVM hypervisor 7.6 is no longer supported
- ▶ Red Hat Enterprise Linux 7.6 is no longer supported as a guest OS

1.7. Updates in Release 11.2

New Features in Release 11.2

- ▶ Miscellaneous bug fixes

1.8. Updates in Release 11.1

New Features in Release 11.1

- ▶ Support for Multi-Instance GPU (MIG)-backed vGPUs on GPUs that support MIG
- ▶ Support for GPUDirect[®] technology remote direct memory access (RDMA)
- ▶ Security updates - see [Security Bulletin: NVIDIA GPU Display Driver - September 2020](#)
- ▶ Miscellaneous bug fixes

Hardware and Software Support Introduced in Release 11.1

- ▶ Support for the following GPUs:
 - ▶ NVIDIA A100 PCIe 40GB
 - ▶ NVIDIA A100 HGX 40GB
- ▶ Support for the following Red Hat hypervisor software releases
 - ▶ Red Hat Enterprise Linux with KVM hypervisor 7.9
 - ▶ Red Hat Virtualization (RHV) 4.4
- ▶ Support for the Red Hat Enterprise Linux 7.9 as a guest OS

Feature Support Withdrawn in Release 11.1

- ▶ Windows Server 2012 R2 is no longer supported as a guest OS with GPUs based on architectures after NVIDIA Turing[™] architecture.

1.9. Updates in Release 11.0

New Features in Release 11.0

- ▶ Cross-branch driver support

This change allows a release of the Virtual GPU Manager from a later major release branch to be used with the NVIDIA vGPU software graphics drivers for the guest VMs from the previous branch.
- ▶ Licensing grace period for unlicensed virtual GPUs and physical GPUs

An unlicensed virtual GPU or physical GPU initially operates at full capability but its performance is degraded over time if a license is not obtained.
- ▶ Miscellaneous bug fixes

Hardware and Software Support Introduced in Release 11.0

- ▶ Support for Windows 10 May 2020 Update (2004) as a guest OS

Feature Support Withdrawn in Release 11.0

- ▶ The following guest OS releases are no longer supported:
 - ▶ Windows Server 2012
 - ▶ Windows Server 2008 R2
 - ▶ Windows 8.1
 - ▶ Windows 8
 - ▶ Windows 7

Chapter 2. Validated Platforms

This release family of NVIDIA vGPU software provides support for several NVIDIA GPUs on validated server hardware platforms, Red Hat Enterprise Linux with KVM hypervisor software versions, and guest operating systems. It also supports the version of NVIDIA CUDA Toolkit that is compatible with R450 drivers.

2.1. Supported NVIDIA GPUs and Validated Server Platforms

This release of NVIDIA vGPU software provides support for the following NVIDIA GPUs on Red Hat Enterprise Linux with KVM, running on validated server hardware platforms:

- ▶ GPUs based on the NVIDIA Maxwell™ graphic architecture:
 - ▶ Tesla M6 (NVIDIA Virtual Compute Server (vCS) is **not** supported.)
 - ▶ Tesla M10 (vCS is **not** supported.)
 - ▶ Tesla M60 (vCS is **not** supported.)
- ▶ GPUs based on the NVIDIA Pascal™ architecture:
 - ▶ Tesla P4
 - ▶ Tesla P6
 - ▶ Tesla P40
 - ▶ Tesla P100 PCIe 16 GB
 - ▶ Tesla P100 SXM2 16 GB
 - ▶ Tesla P100 PCIe 12GB
- ▶ GPUs based on the NVIDIA Volta architecture:
 - ▶ Tesla V100 SXM2
 - ▶ Tesla V100 SXM2 32GB
 - ▶ Tesla V100 PCIe
 - ▶ Tesla V100 PCIe 32GB
 - ▶ Tesla V100S PCIe 32GB

- ▶ Tesla V100 FHHL
- ▶ GPUs based on the NVIDIA Turing™ architecture:
 - ▶ Tesla T4
 - ▶ Quadro RTX 6000 in displayless mode
 - ▶ Quadro RTX 6000 passive in displayless mode
 - ▶ Quadro RTX 8000 in displayless mode
 - ▶ Quadro RTX 8000 passive in displayless mode

In displayless mode, local physical display connectors are disabled.

- ▶ GPUs based on the NVIDIA Ampere architecture:
 - ▶ **Since 11.1:** NVIDIA A100 PCIe 40GB (supports **only** compute workloads on Linux with NVIDIA Virtual Compute Server and GPU pass through; graphics acceleration is **not** supported)
 - ▶ **Since 11.1:** NVIDIA A100 HGX 40GB (supports **only** compute workloads on Linux with NVIDIA Virtual Compute Server and GPU pass through; graphics acceleration is **not** supported)

For a list of validated server platforms, refer to [NVIDIA GRID Certified Servers](#).



Note:

Tesla M60 and M6 GPUs support compute mode and graphics mode. NVIDIA vGPU requires GPUs that support both modes to operate in graphics mode.

Recent Tesla M60 GPUs and M6 GPUs are supplied in graphics mode. However, your GPU might be in compute mode if it is an older Tesla M60 GPU or M6 GPU, or if its mode has previously been changed.

To configure the mode of Tesla M60 and M6 GPUs, use the `gpumodeswitch` tool provided with NVIDIA vGPU software releases.

Even in compute mode, Tesla M60 and M6 GPUs do **not** support NVIDIA Virtual Compute Server vGPU types.

2.2. Hypervisor Software Releases

This release supports **only** the hypervisor software releases listed in the table.



Note: If a specific release, even an update release, is not listed, it's **not** supported.

Software	Releases Supported	Notes
Since 11.4: Red Hat Enterprise Linux with KVM	8.4	All NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.
11.3, 11.4 only: Red Hat Enterprise Linux with KVM	8.3	All NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.
Red Hat Enterprise Linux with KVM	8.2	<p>All NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.</p> <p>Since 11.1: The following GPUs are not supported in any mode on NVIDIA vGPU software 11.0:</p> <ul style="list-style-type: none"> ▶ NVIDIA A100 PCIe 40GB ▶ NVIDIA A100 HGX 40GB
Red Hat Enterprise Linux with KVM	8.1	<p>Since 11.1: The following GPUs are supported in GPU pass through mode only and are not supported in any mode on NVIDIA vGPU software 11.0:</p> <ul style="list-style-type: none"> ▶ NVIDIA A100 PCIe 40GB ▶ NVIDIA A100 HGX 40GB <p>All other NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.</p>
Since 11.1: Red Hat Enterprise Linux with KVM	7.9	<p>The following GPUs are supported in GPU pass through mode only:</p> <ul style="list-style-type: none"> ▶ NVIDIA A100 PCIe 40GB ▶ NVIDIA A100 HGX 40GB <p>All other NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.</p>
Red Hat Enterprise Linux with KVM	7.8, 7.7	<p>Since 11.1: The following GPUs are supported in GPU pass through mode only and are not supported in any mode on NVIDIA vGPU software 11.0:</p> <ul style="list-style-type: none"> ▶ NVIDIA A100 PCIe 40GB ▶ NVIDIA A100 HGX 40GB <p>All other NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.</p>

Software	Releases Supported	Notes
11.0-11.2 only: Red Hat Enterprise Linux with KVM	7.6	<p>Since 11.1: The following GPUs are supported in GPU pass through mode only and are not supported in any mode on NVIDIA vGPU software 11.0:</p> <ul style="list-style-type: none"> ▶ NVIDIA A100 PCIe 40GB ▶ NVIDIA A100 HGX 40GB <p>All other NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.</p>
Since 11.1: Red Hat Virtualization (RHV)	4.4	<p>The following GPUs are supported in GPU pass through mode only and are not supported in any mode on NVIDIA vGPU software 11.0:</p> <ul style="list-style-type: none"> ▶ NVIDIA A100 PCIe 40GB ▶ NVIDIA A100 HGX 40GB <p>All other NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.</p>
Red Hat Virtualization (RHV)	4.3, 4.2	<p>Since 11.1: The following GPUs are supported in GPU pass through mode only and are not supported in any mode on NVIDIA vGPU software 11.0:</p> <ul style="list-style-type: none"> ▶ NVIDIA A100 PCIe 40GB ▶ NVIDIA A100 HGX 40GB <p>All other NVIDIA GPUs that NVIDIA vGPU software supports are supported with vGPU and in pass-through mode.</p>

2.3. Guest OS Support

NVIDIA vGPU software supports several Windows releases and Linux distributions as a guest OS. The supported guest operating systems depend on the hypervisor software version.



Note:

Use only a guest OS release that is listed as supported by NVIDIA vGPU software with your virtualization software. To be listed as supported, a guest OS release must be supported not only by NVIDIA vGPU software, but also by your virtualization software. NVIDIA **cannot** support guest OS releases that your virtualization software does not support.

NVIDIA vGPU software supports **only** 64-bit guest operating systems. No 32-bit guest operating systems are supported.

2.3.1. Windows Guest OS Support



Note: Red Hat Enterprise Linux with KVM and Red Hat Virtualization (RHV) support Windows guest operating systems only under specific Red Hat subscription programs. For details, see:

- ▶ [Certified guest operating systems for Red Hat Enterprise Linux with KVM](#)
- ▶ [Certified Guest Operating Systems in Red Hat OpenStack Platform and Red Hat Enterprise Virtualization](#)

NVIDIA vGPU software supports **only** the 64-bit Windows releases listed in the table as a guest OS on Red Hat Enterprise Linux with KVM. The releases of Red Hat Enterprise Linux with KVM for which a Windows release is supported depend on whether NVIDIA vGPU or pass-through GPU is used.



Note:

If a specific release, even an update release, is not listed, it's **not** supported.

Guest OS	NVIDIA vGPU - Red Hat Enterprise Linux with KVM Releases	Pass-Through GPU - Red Hat Enterprise Linux with KVM Releases
Windows Server 2019	<p>Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6</p> <p>11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6</p> <p>Since 11.1: RHV 4.4, 4.3, 4.2</p> <p>11.0 only: RHV 4.3, 4.2</p>	<p>Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6</p> <p>11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6</p> <p>Since 11.1: RHV 4.4, 4.3, 4.2</p> <p>11.0 only: RHV 4.3, 4.2</p>
Windows Server 2016 1709, 1607	<p>Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p>	<p>Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p> <p>11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7</p>

Guest OS	NVIDIA vGPU - Red Hat Enterprise Linux with KVM Releases	Pass-Through GPU - Red Hat Enterprise Linux with KVM Releases
	11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2	11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2
Windows Server 2012 R2 (not supported on GPUs based on architectures after the NVIDIA Turing™ architecture)	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2
Since 11.3: Windows 10 May 2021 Update (21H1) and all Windows 10 releases supported by Microsoft up to and including this release See Note [1]	RHV 4.4, 4.3, 4.2	RHV 4.4, 4.3, 4.2
11.0-11.2 only: Windows 10 May 2020 Update (2004) and all Windows 10 releases supported by Microsoft up to and including this release See Note [1]	11.1, 11.2 only: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2	11.1, 11.2 only: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2

**Note:**

1. The hardware-accelerated GPU scheduling feature introduced in Windows 10 May 2020 Update (2004) is **not** supported on GPUs based on the Maxwell architecture and is supported only in pass-through mode on GPUs based on later architectures.

2.3.2. Linux Guest OS Support

NVIDIA vGPU software supports **only** the 64-bit Linux distributions listed in the table as a guest OS on Red Hat Enterprise Linux with KVM. The releases of Red Hat Enterprise Linux with KVM for which a Linux release is supported depend on whether NVIDIA vGPU or pass-through GPU is used.



Note:

If a specific release, even an update release, is not listed, it's **not** supported.

Guest OS	NVIDIA vGPU - Red Hat Enterprise Linux with KVM Releases	Pass-Through GPU - Red Hat Enterprise Linux with KVM Releases
Since 11.4: Red Hat Enterprise Linux 8.4	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1
11.3, 11.4 only: Red Hat Enterprise Linux 8.3	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1
Red Hat Enterprise Linux 8.2	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1
Red Hat Enterprise Linux 8.1	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1
CentOS Linux 8 (1911)	Since 11.5: RHEL KVM 8.4, 8.2, 8.1	Since 11.5: RHEL KVM 8.4, 8.2, 8.1

Guest OS	NVIDIA vGPU - Red Hat Enterprise Linux with KVM Releases	Pass-Through GPU - Red Hat Enterprise Linux with KVM Releases
	11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1	11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1
CentOS 8.0	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1	Since 11.5: RHEL KVM 8.4, 8.2, 8.1 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1 11.3 only: RHEL KVM 8.3, 8.2, 8.1 11.0-11.2 only: RHEL KVM 8.2, 8.1
Since 11.3: Red Hat Enterprise Linux 7.7-7.9	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 RHV 4.4, 4.3, 4.2	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 RHV 4.4, 4.3, 4.2
11.1-11.2 only: Red Hat Enterprise Linux 7.6-7.9	RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 RHV 4.4, 4.3, 4.2	RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 RHV 4.4, 4.3, 4.2
11.0 only: Red Hat Enterprise Linux 7.6-7.8	RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 RHV 4.3, 4.2	RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 RHV 4.3, 4.2
CentOS 7.6-7.8 See Note [1]	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6

Guest OS	NVIDIA vGPU - Red Hat Enterprise Linux with KVM Releases	Pass-Through GPU - Red Hat Enterprise Linux with KVM Releases
	11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2	11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2
Red Hat Enterprise Linux 6.6	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2
CentOS 6.6 See Note [1]	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2	Since 11.5: RHEL KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 11.4 only: RHEL KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.3 only: RHEL KVM 8.3, 8.2, 8.1, 7.9, 7.8, 7.7 11.1-11.2 only: RHEL KVM 8.2, 8.1, 7.9, 7.8, 7.7, 7.6 11.0 only: RHEL KVM 8.2, 8.1, 7.8, 7.7, 7.6 Since 11.1: RHV 4.4, 4.3, 4.2 11.0 only: RHV 4.3, 4.2

**Note:**

1. CentOS is not a certified guest OS for Red Hat Enterprise Linux with KVM or RHV.

2.4. NVIDIA CUDA Toolkit Version Support

The releases in this release family of NVIDIA vGPU software support NVIDIA CUDA Toolkit 11.0.

For more information about NVIDIA CUDA Toolkit, see [CUDA Toolkit 11.0 Documentation](#).



Note:

If you are using NVIDIA vGPU software with CUDA on Linux, avoid conflicting installation methods by installing CUDA from a distribution-independent runfile package. Do not install CUDA from distribution-specific RPM or Deb package.

To ensure that the NVIDIA vGPU software graphics driver is not overwritten when CUDA is installed, deselect the CUDA driver when selecting the CUDA components to install.

For more information, see [NVIDIA CUDA Installation Guide for Linux](#).

2.5. Multiple vGPU Support

To support applications and workloads that are compute or graphics intensive, multiple vGPUs can be added to a single VM. The assignment of more than one vGPU to a VM is supported only on a subset of vGPUs and Red Hat Enterprise Linux with KVM releases.

Supported vGPUs

Only Q-series and C-series time-sliced vGPUs that are allocated all of the physical GPU's frame buffer are supported. MIG-backed vGPUs are **not** supported.

GPU Architecture	Board	vGPU
Since 11.1: Ampere	NVIDIA A100 PCIe 40GB	A100-40C See Note [1] .
	NVIDIA A100 HGX 40GB	A100X-40C See Note [1] .
Turing	Tesla T4	T4-16Q
		T4-16C
	Quadro RTX 6000	RTX6000-24Q
		RTX6000-24C
	Quadro RTX 6000 passive	RTX6000P-24Q
		RTX6000P-24C
	Quadro RTX 8000	RTX8000-48Q
		RTX8000-48C
	Quadro RTX 8000 passive	RTX8000P-48Q
		RTX8000P-48C

GPU Architecture	Board	vGPU
Volta	Tesla V100 SXM2 32GB	V100DX-32Q
		V100D-32C
	Tesla V100 PCIe 32GB	V100D-32Q
		V100D-32C
	Tesla V100S PCIe 32GB	V100S-32Q
		V100S-32C
	Tesla V100 SXM2	V100X-16Q
		V100X-16C
	Tesla V100 PCIe	V100-16Q
		V100-16C
	Tesla V100 FHHL	V100L-16Q
		V100L-16C
Pascal	Tesla P100 SXM2	P100X-16Q
		P100X-16C
	Tesla P100 PCIe 16GB	P100-16Q
		P100-16C
	Tesla P100 PCIe 12GB	P100C-12Q
		P100C-12C
	Tesla P40	P40-24Q
		P40-24C
	Tesla P6	P6-16Q
		P6-16C
	Tesla P4	P4-8Q
		P4-8C
Maxwell	Tesla M60	M60-8Q
	Tesla M10	M10-8Q
	Tesla M6	M6-8Q

**Note:**

1. This type of vGPU cannot be assigned with other types of vGPU to the same VM.

Maximum vGPUs per VM

NVIDIA vGPU software supports up to a maximum of 16 vGPUs per VM on Red Hat Enterprise Linux with KVM.

Supported Hypervisor Releases

Since 11.5: Red Hat Enterprise Linux with KVM 8.4, 8.2, 8.1, 7.9, 7.8, 7.7 only.

11.4 only: Red Hat Enterprise Linux with KVM 8.4, 8.3, 8.2, 8.1, 7.9, 7.8, and 7.7 only.

11.3 only: Red Hat Enterprise Linux with KVM 8.3, 8.2, 8.1, 7.9, 7.8, and 7.7 only.

11.1-11.2 only: Red Hat Enterprise Linux with KVM 8.2, 8.1, 7.9, 7.8, 7.7, and 7.6 only.

11.0 only: Red Hat Enterprise Linux with KVM 8.2, 8.1, 7.8, 7.7, and 7.6 only.

Since 11.1: RHV 4.4, 4.3 and 4.2 only.

11.0 only: RHV 4.3 and 4.2 only.

2.6. Peer-to-Peer CUDA Transfers over NVLink Support

Peer-to-peer CUDA transfers enable device memory between vGPUs on different GPUs that are assigned to the same VM to be accessed from within the CUDA kernels. NVLink is a high-bandwidth interconnect that enables fast communication between such vGPUs. Peer-to-Peer CUDA transfers over NVLink are supported only on a subset of vGPUs, Red Hat Enterprise Linux with KVM releases, and guest OS releases.

Supported vGPUs

Only Q-series and C-series time-sliced vGPUs that are allocated all of the physical GPU's frame buffer on physical GPUs that support NVLink are supported.

GPU Architecture	Board	vGPU
Since 11.1: Ampere	NVIDIA A100 PCIe 40GB	A100-40C
	NVIDIA A100 HGX 40GB	A100X-40C See Note [1] .
Turing	Quadro RTX 6000	RTX6000-24Q
		RTX6000-24C
	Quadro RTX 6000 passive	RTX6000P-24Q
		RTX6000P-24C
	Quadro RTX 8000	RTX8000-48Q
		RTX8000-48C

GPU Architecture	Board	vGPU
Volta	Quadro RTX 8000 passive	RTX8000P-48Q
		RTX8000P-48C
	Tesla V100 SXM2 32GB	V100DX-32Q
		V100DX-32C
	Tesla V100 SXM2	V100X-16Q
		V100X-16C
Pascal	Tesla P100 SXM2	P100X-16Q
		P100X-16C

**Note:**

1. Supported only on the NVIDIA HGX A100 4-GPU baseboard with four fully connected GPUs.

Supported Hypervisor Releases

Peer-to-Peer CUDA Transfers over NVLink are supported on all hypervisor releases that support the assignment of more than one vGPU to a VM. For details, see [Multiple vGPU Support](#).

Supported Guest OS Releases

Linux only. Peer-to-Peer CUDA Transfers over NVLink are **not** supported on Windows.

Limitations

- ▶ Only direct connections are supported. NVSwitch is not supported.
- ▶ Only time-sliced vGPUs are supported. MIG-backed vGPUs are **not** supported.
- ▶ PCIe is not supported.
- ▶ SLI is not supported.

2.7. Since 11.1: GPUDirect Technology Support

GPUDirect® technology remote direct memory access (RDMA) enables network devices to directly access vGPU frame buffer, bypassing CPU host memory altogether. GPUDirect technology is supported only on a subset of vGPUs and guest OS releases.

Supported vGPUs

Only C-series vGPUs that are allocated all of the physical GPU's frame buffer on physical GPUs based on the NVIDIA Ampere architecture are supported. Both time-sliced and MIG-backed vGPUs that meet these requirements are supported.

GPU Architecture	Board	vGPU
Ampere	NVIDIA A100 PCIe 40GB	A100-40C
		A100-7-40C
	NVIDIA A100 HGX 40GB	A100X-40C
		A100X-7-40C

Supported Guest OS Releases

Linux only. GPUDirect technology is **not** supported on Windows.

Supported Network Interface Cards

GPUDirect technology RDMA is supported on the following network interface cards:

- ▶ Mellanox Connect-X® 6 SmartNIC
- ▶ Mellanox Connect-X 5 Ethernet adapter card

Limitations

Only GPUDirect technology RDMA is supported. GPUDirect technology storage is not supported.

Chapter 3. Known Product Limitations

Known product limitations for this release of NVIDIA vGPU software are described in the following sections.

3.1. Issues occur when the channels allocated to a vGPU are exhausted

Description

Issues occur when the channels allocated to a vGPU are exhausted and the guest VM to which the vGPU is assigned fails to allocate a channel to the vGPU. A physical GPU has a fixed number of channels and the number of channels allocated to each vGPU is inversely proportional to the maximum number of vGPUs allowed on the physical GPU.

When the channels allocated to a vGPU are exhausted and the guest VM fails to allocate a channel, the following errors are reported on the hypervisor host or in an NVIDIA bug report:

```
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0): Guest attempted to
allocate channel above its max channel limit 0xfb
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0): VGPU message 6
failed, result code: 0x1a
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):
0xc1d004a1, 0xff0e0000, 0xff0400fb, 0xc36f,
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):          0x1,
0xff1fe314, 0xff1fe038, 0x100b6f000, 0x1000,
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):
0x80000000, 0xff0e0200, 0x0, 0x0, (Not logged),
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):          0x1, 0x0
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0): , 0x0
```

Workaround

Use a vGPU type with more frame buffer, thereby reducing the maximum number of vGPUs allowed on the physical GPU. As a result, the number of channels allocated to each vGPU is increased.

3.2. Virtual GPU hot plugging is not supported

NVIDIA vGPU software does not support the addition of virtual function I/O (VFIO) mediated device (`mdev`) devices after the VM has been started by QEMU. All `mdev` devices must be added before the VM is started.

3.3. Total frame buffer for vGPUs is less than the total frame buffer on the physical GPU

Some of the physical GPU's frame buffer is used by the hypervisor on behalf of the VM for allocations that the guest OS would otherwise have made in its own frame buffer. The frame buffer used by the hypervisor is not available for vGPUs on the physical GPU. In NVIDIA vGPU deployments, frame buffer for the guest OS is reserved in advance, whereas in bare-metal deployments, frame buffer for the guest OS is reserved on the basis of the runtime needs of applications.

If error-correcting code (ECC) memory is enabled on a physical GPU that does not have HBM2 memory, the amount of frame buffer that is usable by vGPUs is further reduced. All types of vGPU are affected, not just vGPUs that support ECC memory.

On all GPUs that support ECC memory and, therefore, dynamic page retirement, additional frame buffer is allocated for dynamic page retirement. The amount that is allocated is inversely proportional to the maximum number of vGPUs per physical GPU. All GPUs that support ECC memory are affected, even GPUs that have HBM2 memory or for which ECC memory is disabled.

The approximate amount of frame buffer that NVIDIA vGPU software reserves can be calculated from the following formula:

$$\text{max-reserved-fb} = \text{vgpu-profile-size-in-mb} \div 16 + 16 + \text{ecc-adjustments} + \text{page-retirement-allocation} + \text{compression-adjustment}$$

max-reserved-fb

The maximum total amount of reserved frame buffer in Mbytes that is not available for vGPUs.

vgpu-profile-size-in-mb

The amount of frame buffer in Mbytes allocated to a single vGPU. This amount depends on the vGPU type. For example, for the T4-16Q vGPU type, *vgpu-profile-size-in-mb* is 16384.

ecc-adjustments

The amount of frame buffer in Mbytes that is not usable by vGPUs when ECC is enabled on a physical GPU that does not have HBM2 memory.

- ▶ If ECC is enabled on a physical GPU that does not have HBM2 memory *ecc-adjustments* is $fb-without-ecc/16$, which is equivalent to 64 Mbytes for every Gbyte of frame buffer assigned to the vGPU. *fb-without-ecc* is total amount of frame buffer with ECC disabled.
- ▶ If ECC is disabled or the GPU has HBM2 memory, *ecc-adjustments* is 0.

page-retirement-allocation

The amount of frame buffer in Mbytes that is reserved for dynamic page retirement.

- ▶ On GPUs based on the NVIDIA Maxwell GPU architecture, *page-retirement-allocation* = $4 \div max-vgpu-per-gpu$.
- ▶ On GPUs based on NVIDIA GPU architectures **after** the Maxwell architecture, *page-retirement-allocation* = $128 \div max-vgpu-per-gpu$

max-vgpu-per-gpu

The maximum number of vGPUs that can be created simultaneously on a physical GPU. This number varies according to the vGPU type. For example, for the T4-16Q vGPU type, *max-vgpu-per-gpu* is 1.

compression-adjustment

The amount of frame buffer in Mbytes that is reserved for the higher compression overhead in vGPU types with 12 Gbytes or more of frame buffer on GPUs based on the Turing architecture.

compression-adjustment depends on the vGPU type as shown in the following table.

vGPU Type	Compression Adjustment (MB)
T4-16Q T4-16C T4-16A	28
RTX6000-12Q RTX6000-12C RTX6000-12A	32
RTX6000-24Q RTX6000-24C RTX6000-24A	104
RTX6000P-12Q RTX6000P-12C RTX6000P-12A	32
RTX6000P-24Q RTX6000P-24C RTX6000P-24A	104
RTX8000-12Q RTX8000-12C	32

vGPU Type	Compression Adjustment (MB)
RTX8000-12A	
RTX8000-16Q RTX8000-16C RTX8000-16A	64
RTX8000-24Q RTX8000-24C RTX8000-24A	96
RTX8000-48Q RTX8000-48C RTX8000-48A	238
RTX8000P-12Q RTX8000P-12C RTX8000P-12A	32
RTX8000P-16Q RTX8000P-16C RTX8000P-16A	64
RTX8000P-24Q RTX8000P-24C RTX8000P-24A	96
RTX8000P-48Q RTX8000P-48C RTX8000P-48A	238

For all other vGPU types, *compression-adjustment* is 0.



Note: In VMs running Windows Server 2012 R2, which supports Windows Display Driver Model (WDDM) 1.x, an additional 48 Mbytes of frame buffer are reserved and not available for vGPUs.

3.4. Issues may occur with graphics-intensive OpenCL applications on vGPU types with limited frame buffer

Description

Issues may occur when graphics-intensive OpenCL applications are used with vGPU types that have limited frame buffer. These issues occur when the applications demand more frame buffer than is allocated to the vGPU.

For example, these issues may occur with the Adobe Photoshop and LuxMark OpenCL Benchmark applications:

- ▶ When the image resolution and size are changed in Adobe Photoshop, a program error may occur or Photoshop may display a message about a problem with the graphics hardware and a suggestion to disable OpenCL.
- ▶ When the LuxMark OpenCL Benchmark application is run, XID error 31 may occur.

Workaround

For graphics-intensive OpenCL applications, use a vGPU type with more frame buffer.

3.5. In pass through mode, all GPUs connected to each other through NVLink must be assigned to the same VM

Description

In pass through mode, all GPUs connected to each other through NVLink must be assigned to the same VM. If a subset of GPUs connected to each other through NVLink is passed through to a VM, unrecoverable error `XID 74` occurs when the VM is booted. This error corrupts the NVLink state on the physical GPUs and, as a result, the NVLink bridge between the GPUs is unusable.

Workaround

Restore the NVLink state on the physical GPUs by resetting the GPUs or rebooting the hypervisor host.

3.6. vGPU profiles with 512 Mbytes or less of frame buffer support only 1 virtual display head on Windows 10

Description

To reduce the possibility of memory exhaustion, vGPU profiles with 512 Mbytes or less of frame buffer support only 1 virtual display head on a Windows 10 guest OS.

The following vGPU profiles have 512 Mbytes or less of frame buffer:

- ▶ Tesla M6-0B, M6-0Q
- ▶ Tesla M10-0B, M10-0Q
- ▶ Tesla M60-0B, M60-0Q

Workaround

Use a profile that supports more than 1 virtual display head and has at least 1 Gbyte of frame buffer.

3.7. NVENC requires at least 1 Gbyte of frame buffer

Description

Using the frame buffer for the NVIDIA hardware-based H.264/HEVC video encoder (NVENC) may cause memory exhaustion with vGPU profiles that have 512 Mbytes or less of frame buffer. To reduce the possibility of memory exhaustion, NVENC is disabled on profiles that have 512 Mbytes or less of frame buffer. Application GPU acceleration remains fully supported and available for all profiles, including profiles with 512 Mbytes or less of frame buffer. NVENC support from both Citrix and VMware is a recent feature and, if you are using an older version, you should experience no change in functionality.

The following vGPU profiles have 512 Mbytes or less of frame buffer:

- ▶ Tesla M6-0B, M6-0Q
- ▶ Tesla M10-0B, M10-0Q
- ▶ Tesla M60-0B, M60-0Q

Workaround

If you require NVENC to be enabled, use a profile that has at least 1 Gbyte of frame buffer.

3.8. VM running an incompatible NVIDIA vGPU guest driver fails to initialize vGPU when booted

Description

A VM running a version of the NVIDIA guest VM driver that is incompatible with the current release of Virtual GPU Manager will fail to initialize vGPU when booted on a Red Hat Enterprise Linux with KVM platform running that release of Virtual GPU Manager.

A guest VM driver is incompatible with the current release of Virtual GPU Manager in either of the following situations:

- ▶ The guest driver is from a release in a branch two or more major releases before the current release, for example release 9.4.

In this situation, the Red Hat Enterprise Linux with KVM VM's `/var/log/messages` log file reports the following error:

```
vmiop_log: (0x0): Incompatible Guest/Host drivers: Guest VGX version is older than the minimum version supported by the Host. Disabling vGPU.
```

- ▶ The guest driver is from a later release than the Virtual GPU Manager.

In this situation, the Red Hat Enterprise Linux with KVM VM's `/var/log/messages` log file reports the following error:

```
vmiop_log: (0x0): Incompatible Guest/Host drivers: Guest VGX version is newer than the maximum version supported by the Host. Disabling vGPU.
```

In either situation, the VM boots in standard VGA mode with reduced resolution and color depth. The NVIDIA virtual GPU is present in **Windows Device Manager** but displays a warning sign, and the following device status:

```
Windows has stopped this device because it has reported problems. (Code 43)
```

Resolution

Install a release of the NVIDIA guest VM driver that is compatible with current release of Virtual GPU Manager.

3.9. Single vGPU benchmark scores are lower than pass-through GPU

Description

A single vGPU configured on a physical GPU produces lower benchmark scores than the physical GPU run in pass-through mode.

Aside from performance differences that may be attributed to a vGPU's smaller frame buffer size, vGPU incorporates a performance balancing feature known as Frame Rate Limiter (FRL). On vGPUs that use the best-effort scheduler, FRL is enabled. On vGPUs that use the fixed share or equal share scheduler, FRL is disabled.

FRL is used to ensure balanced performance across multiple vGPUs that are resident on the same physical GPU. The FRL setting is designed to give good interactive remote graphics experience but may reduce scores in benchmarks that depend on measuring frame rendering rates, as compared to the same benchmarks running on a pass-through GPU.

Resolution

FRL is controlled by an internal vGPU setting. On vGPUs that use the best-effort scheduler, NVIDIA does not validate vGPU with FRL disabled, but for validation of benchmark performance, FRL can be temporarily disabled by setting `frame_rate_limiter=0` in the vGPU configuration file.

```
# echo "frame_rate_limiter=0" > /sys/bus/mdev/devices/vgpu-id/nvidia/vgpu_params
```

For example:

```
# echo "frame_rate_limiter=0" > /sys/bus/mdev/devices/aa618089-8b16-4d01-a136-25a0f3c73123/nvidia/vgpu_params
```

The setting takes effect the next time any VM using the given vGPU type is started.

With this setting in place, the VM's vGPU will run without any frame rate limit.

The FRL can be reverted back to its default setting as follows:

1. Clear all parameter settings in the vGPU configuration file.

```
# echo " " > /sys/bus/mdev/devices/vgpu-id/nvidia/vgpu_params
```



Note: You cannot clear specific parameter settings. If your vGPU configuration file contains other parameter settings that you want to keep, you must reinstate them in the next step.

2. Set `frame_rate_limiter=1` in the vGPU configuration file.

```
# echo "frame_rate_limiter=1" > /sys/bus/mdev/devices/vgpu-id/nvidia/vgpu_params
```

If you need to reinstate other parameter settings, include them in the command to set `frame_rate_limiter=1`. For example:


```
# echo "frame_rate_limiter=1 disable_vnc=1" > /sys/bus/mdev/devices/aa618089-8b16-4d01-a136-25a0f3c73123/nvidia/vgpu_params
```

3.10. `nvidia-smi` fails to operate when all GPUs are assigned to GPU pass-through mode

Description

If all GPUs in the platform are assigned to VMs in pass-through mode, `nvidia-smi` will return an error:

```
[root@vgx-test ~]# nvidia-smi
Failed to initialize NVML: Unknown Error
```

This is because GPUs operating in pass-through mode are not visible to `nvidia-smi` and the NVIDIA kernel driver operating in the Red Hat Enterprise Linux with KVM host.

To confirm that all GPUs are operating in pass-through mode, confirm that the `vfio-pci` kernel driver is handling each device.

```
# lspci -s 05:00.0 -k
05:00.0 VGA compatible controller: NVIDIA Corporation GM204GL [Tesla M60] (rev a1)
        Subsystem: NVIDIA Corporation Device 113a
        Kernel driver in use: vfio-pci
```

Resolution

N/A

Chapter 4. Resolved Issues

Only resolved issues that have been previously noted as known issues or had a noticeable user impact are listed. The summary and description for each resolved issue indicate the effect of the issue on NVIDIA vGPU software **before the issue was resolved**.

Issues Resolved in Release 11.6

No resolved issues are reported in this release for Red Hat Enterprise Linux with KVM.

Issues Resolved in Release 11.5

No resolved issues are reported in this release for Red Hat Enterprise Linux with KVM.

Issues Resolved in Release 11.4

Bug ID	Summary and Description
3184762	<p><u>11.0-11.3 Only: Rebooting a Windows 10 vGPU VM causes a host crash</u></p> <p>When a Windows 10 VM that is configured with NVIDIA vGPU is rebooted, the hypervisor host crashes. This issue is caused by the failure of the Virtual GPU Manager to honor a particular notifier request from the kernel, which causes the kernel to crash.</p>

Issues Resolved in Release 11.3

Bug ID	Summary and Description
200664572	<p><u>11.0-11.2 Only: Sessions freeze randomly with XID errors 38, 43, 32, and 31</u></p> <p>Issues such as a session freeze, black screen, application crash, or VM crash might randomly occur with VMs that are configured with a Tesla T4 vGPU. When these issues occur, XID error 38 followed by multiple instances of XID errors 43, 32, and 31 are written to the log files on the hypervisor host. This issue is caused by a regression in the NVIDIA firmware code for the Tesla T4 GPU and affects only VMs that are configured with a vGPU that resides on a Tesla T4 GPU.</p>

Issues Resolved in Release 11.2

Bug ID	Summary and Description
200658253	<p><u>11.1 Only: Licensing event logs indicate license renewal from unavailable primary server</u></p> <p>Licensing event logs for the guest VM indicate that a license is renewed from primary license server even when primary license server is unavailable and the license is renewed from the secondary server.</p>

Issues Resolved in Release 11.1

Bug ID	Summary and Description
200627445	<p><u>11.0 Only: Remoting solution session freezes with VGPU message 21 failed and VGPU message 14 failed errors</u></p> <p>The remoting solution session sometimes freezes while a window is being resized. For a Windows guest VM, the error message <code>VGPU message 21 failed</code> is written to the log file on the hypervisor host. For a Linux guest VM, the error messages <code>VGPU message 21 failed</code> and <code>VGPU message 14 failed</code> are written to the log file on the hypervisor host.</p>
200626446	<p><u>11.0 Only: Failure to allocate resources causes VM failures or crashes</u></p> <p>Failure to allocate resources causes VM failures or crashes. When the error occurs, the error message <code>NVOS status 0x19</code> is written to the log file on the hypervisor host. Depending on the resource and the underlying cause of the failure, <code>VGPU message 52 failed</code>, <code>VGPU message 4 failed</code>, <code>VGPU message 21 failed</code>, and <code>VGPU message 10 failed</code> might also be written to the log file on the hypervisor host.</p>
3051614	<p><u>11.0 Only: Application responsiveness degrades over time</u></p> <p>Application responsiveness degrades over time, causing slow application performance and stutter when users switch between applications. This issue occurs because the GPU driver is not setting the Linux kernel PCI <code>coherent_dma_mask</code> for NVIDIA GPU devices. If the <code>coherent_dma_mask</code> is not set, IOMMU IOVA space is restricted to the default size of 32 bits for DMA allocations performed in the NVIDIA GPU device context. Furthermore, for hosts on which <code>iommu=pt</code> is set, the default <code>coherent_dma_mask</code> causes IOMMU mappings to always be created. When IOMMU mappings are always created, performance degradation can occur because all host to device accesses require translation by hardware IOMMU.</p>

Bug ID	Summary and Description
3063042	<p><u>11.0 Only: On systems with more than 1 TiB of system memory, application performance degrades over time</u></p> <p>On systems with more than 1 TiB of system memory, application performance degrades over time. As a result, application performance is slow and stutter occurs when users switch between applications. This issue occurs because the virtual GPU manager temporarily limits the <code>dma_mask</code> and the <code>coherent_dma_mask</code> to 40 bits while the vGPU is being initialized. On systems with more than 1 TiB of system memory, the <code>coherent_dma_mask</code> addressing capability is less than the amount of system memory. As a result, IOMMU mappings are always created, which can cause performance degradation because all host to device accesses require translation by hardware IOMMU.</p>
3087984	<p><u>11.0 Only: The NVIDIA license not present notification appears even for VMs for which the vGPU is licensed</u></p> <p>After starting and logging on to a Windows VM that is configured with NVIDIA vGPU, users see the NVIDIA license not present notification even when the vGPU is already licensed. This notification is misleading and should be ignored. This issue occurs because the NVIDIA driver is not storing the correct NVIDIA vGPU software license state.</p>
2925629	<p><u>11.0 Only: Desktop sessions disconnect after the server becomes unresponsive</u></p> <p>Desktop sessions disconnect after the server becomes unresponsive. Before the sessions disconnect, the error message <code>VGPU message 32 failed, result code: 0x59</code> is written to the log files on the hypervisor host.</p>

Issues Resolved in Release 11.0

Bug ID	Summary and Description
200275925	<p>Resolution is not updated after a VM acquires a license and is restarted</p> <p>In a Red Enterprise Linux 7.3 guest VM, an increase in resolution from 1024×768 to 2560×1600 is not applied after a license is acquired and the <code>gridd</code> service is restarted. This issue occurs if the <code>multimonitor</code> parameter is added to the <code>xorg.conf</code> file.</p>
2175888	<p>Even when the scheduling policy is equal share, unequal GPU utilization is reported</p> <p>When the scheduling policy is equal share, unequal GPU engine utilization can be reported for the vGPUs on the same physical GPU.</p>

Chapter 5. Known Issues

5.1. Since 11.6: NVENC does not work with Teradici Cloud Access Software on Windows

Description

The NVIDIA hardware-based H.264/HEVC video encoder (NVENC) does not work with Teradici Cloud Access Software on Windows. This issue affects NVIDIA vGPU and GPU pass through deployments.

This issue occurs because the check that Teradici Cloud Access Software performs on the DLL signer name is case sensitive and NVIDIA recently changed the case of the company name in the signature certificate.

Status

Not an NVIDIA bug

This issue is resolved in the latest 21.07 and 21.03 Teradici Cloud Access Software releases.

Ref.

200749065

5.2. A licensed client might fail to acquire a license if a proxy is set

Description

If a proxy is set with a system environment variable such as `HTTP_PROXY` or `HTTPS_PROXY`, a licensed client might fail to acquire a license.

Workaround

Perform this workaround on each affected licensed client.

1. Add the address of the NVIDIA vGPU software license server to the system environment variable `NO_PROXY`.

The address must be specified exactly as it is specified in the client's license server settings either as a fully-qualified domain name or an IP address. If the `NO_PROXY` environment variable contains multiple entries, separate the entries with a comma (,).

If high availability is configured for the license server, add the addresses of the primary license server and the secondary license server to the system environment variable `NO_PROXY`.

2. Restart the NVIDIA driver service that runs the core NVIDIA vGPU software logic.
 - ▶ On Windows, restart the **NVIDIA Display Container** service.
 - ▶ On Linux, restart the `nvidia-gridd` service.

Status

Closed

Ref.

200704733

5.3. Session connection fails with four 4K displays and NVENC enabled on a 2Q, 3Q, or 4Q vGPU

Description

Desktop session connections fail for a 2Q, 3Q, or 4Q vGPU that is configured with four 4K displays and for which the NVIDIA hardware-based H.264/HEVC video encoder (NVENC) is enabled. This issue affects only Teradici Cloud Access Software sessions on Linux guest VMs.

This issue is accompanied by the following error message:

```
This Desktop has no resources available or it has timed out
```

This issue is caused by insufficient frame buffer.

Workaround

Ensure that sufficient frame buffer is available for all the virtual displays that are connected to a vGPU by changing the configuration in one of the following ways:

- ▶ Reducing the number of virtual displays. The number of 4K displays supported with NVENC enabled depends on the vGPU.

vGPU	4K Displays Supported with NVENC Enabled
2Q	1
3Q	2
4Q	3

- ▶ Disabling NVENC. The number of 4K displays supported with NVENC disabled depends on the vGPU.

vGPU	4K Displays Supported with NVENC Disabled
2Q	2
3Q	2
4Q	4

- ▶ Using a vGPU type with more frame buffer. Four 4K displays with NVENC enabled on any Q-series vGPU with at least 6144 MB of frame buffer are supported.

Status

Not an NVIDIA bug

Ref.

200701959

5.4. 11.0-11.3 Only: Rebooting a Windows 10 vGPU VM causes a host crash

Description

When a Windows 10 VM that is configured with NVIDIA vGPU is rebooted, the hypervisor host crashes. This issue is caused by the failure of the Virtual GPU Manager to honor a particular notifier request from the kernel, which causes the kernel to crash.

Status

Resolved in NVIDIA vGPU software 11.4.

Ref.

3184762

5.5. For some accounted processes, `nvidia-smi` incorrectly reports maximum memory use of 0 MiB

Description

When the `--query-accounted-apps` option is used to list accounted compute processes, the `nvidia-smi` command incorrectly reports that the maximum memory use of some processes is 0 MiB. With the `--query-accounted-apps` option, `nvidia-smi` reports the maximum memory used by an application during its lifetime, and other information such as which GPU the application is running on and GR engine utilization.

Status

Open

Ref.

200647764

5.6. 11.0 Only: Desktop sessions disconnect after the server becomes unresponsive

Description

Desktop sessions disconnect after the server becomes unresponsive. Before the sessions disconnect, the error message `VGPU message 32 failed, result code: 0x59` is written to the log files on the hypervisor host.

Status

Resolved in NVIDIA vGPU software 11.1

Ref.

2925629

5.7. 11.0-11.2 Only: Sessions freeze randomly with XID errors 38, 43, 32, and 31

Description

Issues such as a session freeze, black screen, application crash, or VM crash might randomly occur with VMs that are configured with a Tesla T4 vGPU. When these issues occur, XID error 38 followed by multiple instances of XID errors 43, 32, and 31 are written to the log files on the hypervisor host. This issue is caused by a regression in the NVIDIA firmware code for the Tesla T4 GPU and affects only VMs that are configured with a vGPU that resides on a Tesla T4 GPU.

Status

Resolved in NVIDIA vGPU software 11.3

Ref.

200664572

5.8. Since 11.1: Idle NVIDIA A100 GPUs show 100% GPU utilization

Description

The `nvidia-smi` command shows 100% GPU utilization for NVIDIA A100 GPUs even if no vGPUs have been configured or no VMs are running. This issue affects only NVIDIA A100 GPUs on which the `sriov-manage` script has **not** been run to enable the virtual function for the GPU in the `sysfs` file system.

```
[root@host ~]# nvidia-smi
Fri Oct 29 11:45:28 2021
```

NVIDIA-SMI 450.156 Driver Version: 450.156 CUDA Version: 11.0									
GPU	Name	Persistence-M	Bus-Id	Disp.A	Volatile	Uncorr.	ECC		
Fan	Temp	Perf	Pwr:Usage/Cap	Memory-Usage	GPU-Util	Compute M.	MIG M.		
0	A100-PCIE-40GB	On	00000000:5E:00.0	Off			0		
N/A	50C	P0	97W / 250W	0MiB / 40537MiB	100%	Default	Disabled		

```
Processes:
```

GPU	GI	CI	PID	Type	Process name	GPU Memory
	ID	ID				Usage
No running processes found						

Workaround

Run the `sriov-manage` script to enable the virtual function for the GPU in the `sysfs` file system as explained in [Virtual GPU Software User Guide](#).

After the script has been run, the `nvidia-smi` command shows 0% GPU utilization for idle NVIDIA A100 GPUs.

```
root@host ~]# nvidia-smi
Fri Oct 29 11:47:38 2021
```

NVIDIA-SMI 450.156 Driver Version: 450.156 CUDA Version: 11.0									
GPU	Name	Persistence-M	Bus-Id	Disp.A	Volatile	Uncorr. ECC			
Fan	Temp	Perf	Pwr:Usage/Cap	Memory-Usage	GPU-Util	Compute M.	MIG M.		
0	A100-PCIE-40GB	On	00000000:5E:00.0	Off		0			
N/A	50C	P0	97W / 250W	0MiB / 40537MiB	0%	Default	Disabled		

Processes:									
GPU	GI	CI	PID	Type	Process name	GPU Memory			
	ID	ID				Usage			
No running processes found									

Status

Open

Ref.

200605527

5.9. Since 11.1: Guest VM frame buffer listed by `nvidia-smi` for vGPUs on GPUs that support SRIOV is incorrect

Description

The amount of frame buffer listed in a guest VM by the `nvidia-smi` command for vGPUs on GPUs that support Single Root I/O Virtualization (SR-IOV) is incorrect. Specifically, the amount of frame buffer listed is the amount of frame buffer allocated for the vGPU type minus the size

of the VMMU segment (`vmmu_page_size`). Examples of GPUs that support SRIOV are GPUs based on the NVIDIA Ampere architecture, such as NVIDIA A100 PCIe 40GB or NVIDIA A100 HGX 40GB.

For example, frame buffer for -4C and -20C vGPU types is listed as follows:

- ▶ For -4C vGPU types, frame buffer is listed as 3963 MB instead of 4096 MB.
- ▶ For -20C vGPU types, frame buffer is listed as 20347 MB instead of 20480 MB.

Status

Open

Ref.

200524749

5.10. VMs fail to boot on RHV 4.4

Description

On RHV 4.4, VMs fail to boot with the error `Host doesn't support passthru of host PCI device`. This issue affects GPU pass through deployments with all supported GPUs and NVIDIA vGPU deployments with GPUs based on the NVIDIA Ampere architecture. This issue occurs because the `intel_iommu` parameter and the `nouveau.modeset` parameter are not set correctly.

Version

This issue affects RHV 4.4.

Workaround

Perform this workaround on the hypervisor host. This workaround requires root user privileges on the hypervisor host.

1. In a plain-text editor, edit the file `/boot/loader/entries/rhvh-4.4.1.1-0.20200722.0+1-4.18.0-193.13.2.el8_2.x86_64.conf` to add the following options to the boot options.

- ▶ `nouveau.modeset=0`
- ▶ `intel_iommu=on`



Note: Line breaks have been added to this example to enhance readability.

```
title rhvh-4.4.1.1-0.20200722.0 (4.18.0-193.13.2.el8_2.x86_64)
version 4.18.0-193.13.2.el8_2.x86_64
linux //rhvh-4.4.1.1-0.20200722.0+1/vmlinuz-4.18.0-193.13.2.el8_2.x86_64
```

```

initrd //rhvh-4.4.1.1-0.20200722.0+1/initramfs-4.18.0-193.13.2.el8_2.x86_64.img
options crashkernel=auto resume=/dev/mapper/rhvh00-swap \
rd.lvm.lv=rhvh00/rhvh-4.4.1.1-0.20200722.0+1 rd.lvm.lv=rhvh00/swap \
root=/dev/rhvh00/rhvh-4.4.1.1-0.20200722.0+1 \
boot=UUID=38ff2175-b761-403d-8a91-d7ec9f7ec2f7 rootflags=discard \
img.bootid=rhvh-4.4.1.1-0.20200722.0+1 intel_iommu=on nouveau.modeset=0
id rhel-20200825140238-4.18.0-193.13.2.el8_2.x86_64
grub_users $grub_users
grub_arg --unrestricted
grub_class kernel

```

2. Reboot the hypervisor host machine.

Status

Not an NVIDIA bug

Ref.

200653675

5.11. 11.0 Only: Application responsiveness degrades over time

Description

Application responsiveness degrades over time, causing slow application performance and stutter when users switch between applications. This issue occurs because the GPU driver is not setting the Linux kernel `PCI coherent_dma_mask` for NVIDIA GPU devices. If the `coherent_dma_mask` is not set, IOMMU IOVA space is restricted to the default size of 32 bits for DMA allocations performed in the NVIDIA GPU device context. Furthermore, for hosts on which `iommu=pt` is set, the default `coherent_dma_mask` causes IOMMU mappings to always be created. When IOMMU mappings are always created, performance degradation can occur because all host to device accesses require translation by hardware IOMMU.

Status

Resolved in NVIDIA vGPU software 11.1



Note: On systems with more than 1 TiB of system memory and GPUs based on GPU architectures earlier than the NVIDIA Ampere architecture, a related issue might still cause application performance to degrade over time. For details, see [11.0 Only: On systems with more than 1 TiB of system memory, application performance degrades over time.](#)

Ref.

3051614

5.12. 11.0 Only: On systems with more than 1 TiB of system memory, application performance degrades over time

Description

On systems with more than 1 TiB of system memory, application performance degrades over time. As a result, application performance is slow and stutter occurs when users switch between applications. This issue occurs because the virtual GPU manager temporarily limits the `dma_mask` and the `coherent_dma_mask` to 40 bits while the vGPU is being initialized. On systems with more than 1 TiB of system memory, the `coherent_dma_mask` addressing capability is less than the amount of system memory. As a result, IOMMU mappings are always created, which can cause performance degradation because all host to device accesses require translation by hardware IOMMU.

Workaround

Reduce the amount of system memory to 1 TiB or less.

Status

Resolved in NVIDIA vGPU software 11.1

Ref.

3063042

5.13. 11.1 Only: Licensing event logs indicate license renewal from unavailable primary server

Description

Licensing event logs for the guest VM indicate that a license is renewed from primary license server even when primary license server is unavailable and the license is renewed from the secondary server.

Workaround

None. However, these incorrect event log entries are benign and can be ignored.

Status

Resolved in NVIDIA vGPU software 11.2

Ref.

200658253

5.14. 11.0 Only: The **NVIDIA license not present** notification appears even for VMs for which the vGPU is licensed

Description

After starting and logging on to a Windows VM that is configured with NVIDIA vGPU, users see the **NVIDIA license not present** notification even when the vGPU is already licensed. This notification is misleading and should be ignored. This issue occurs because the NVIDIA driver is not storing the correct NVIDIA vGPU software license state.

Users can confirm that their vGPU is licensed in one of the following ways:

- ▶ Opening **NVIDIA Control Panel** and checking the **Licensing > Manage License** page.
- ▶ Running the following command in a **Command Prompt** window:

```
C:\Program Files\NVIDIA Corporation\NVSMI\nvidia-smi -q
```

Version

This issue affects Windows server and Windows desktop operating systems.


Workaround

While the misleading notifications can be ignored, this workaround can be used to suppress the notifications if they cause confusion.




CAUTION: This workaround suppresses **all** notifications, **even valid notifications**, from **NVIDIA Container**. Therefore, use this workaround only if immediate resolution is needed.


1. When the notification appears, grab it by right-clicking in the notification window.

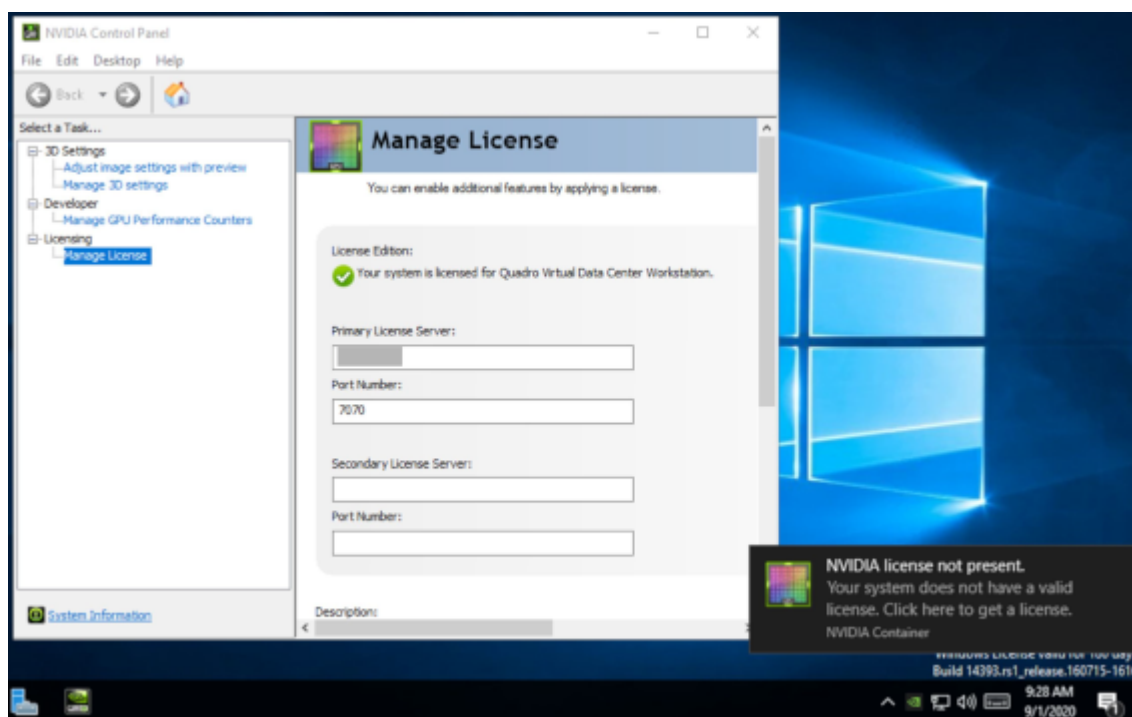

2. In **Action Center**, go to Windows notifications for **NVIDIA Container**, right-click the notification, and click **Go to notification settings**.

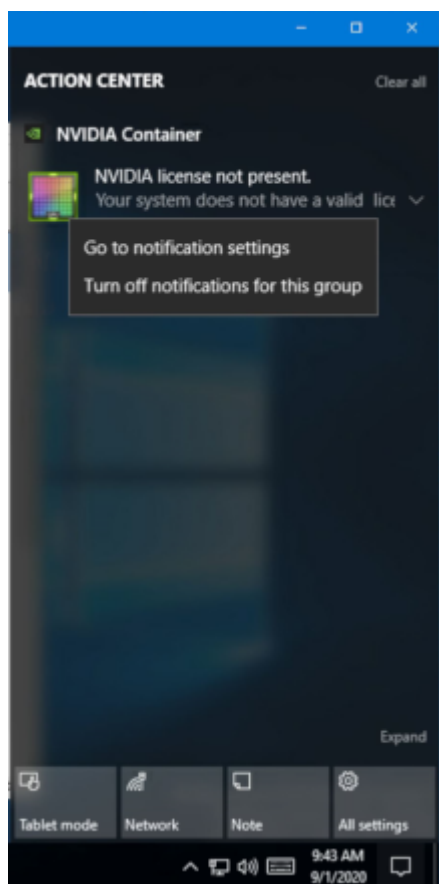


3. In the notification settings for **NVIDIA Container**, set **Show notification banners** to **Off**.

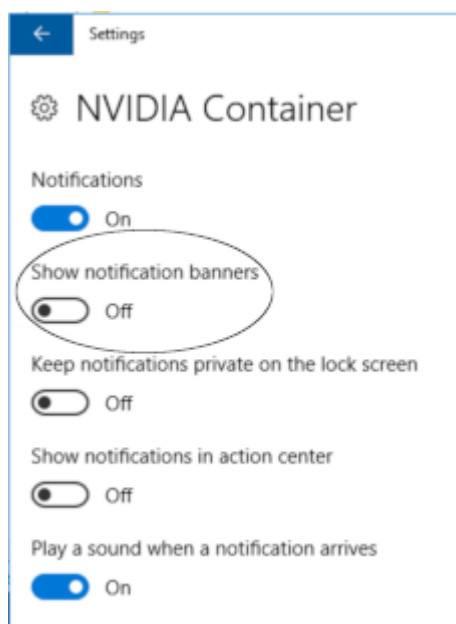


If necessary, you can reenable these notifications in one of the following ways:

- Use **System settings** as follows:


1. In **Notifications & actions**, under **Get notifications from these senders**, select **NVIDIA Container** to see more settings.

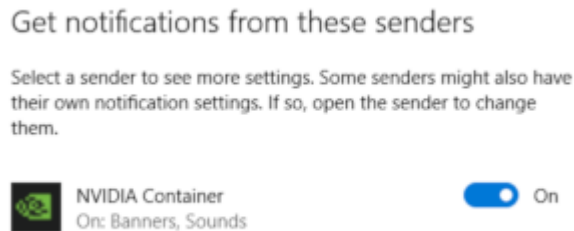

2. In the notification settings for **NVIDIA Container**, set the **Show notification banners** option to **On**.

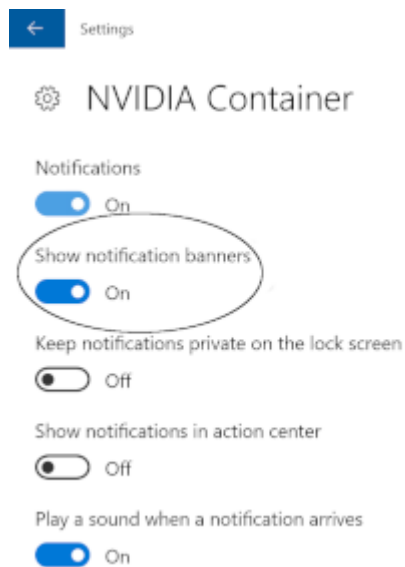

- Set the Windows registry key `HKEY_CURRENT_USER\Software\Microsoft\Windows\CurrentVersion\Notifications\Settings\Microsoft.Explorer.Notification.{D38519CE-37BE-5DFF-CF14-CC1848376559}\ShowBanner` to 1.

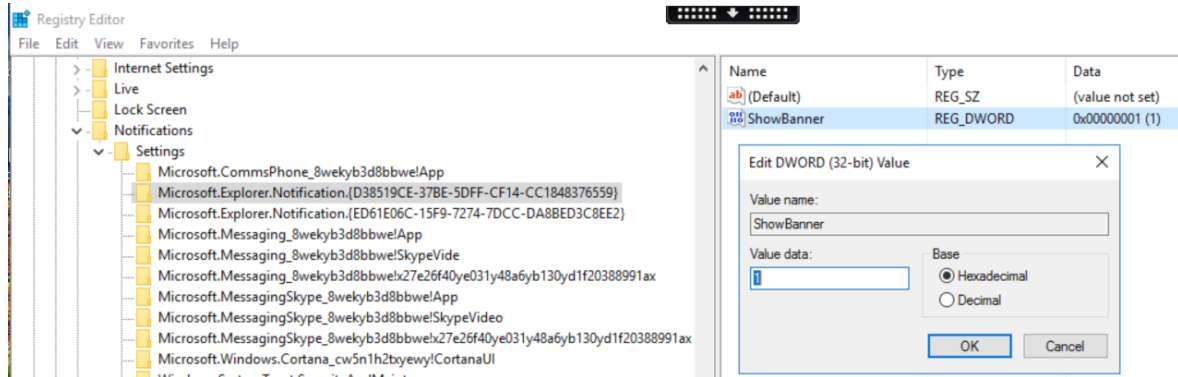

Status

Resolved in NVIDIA vGPU software 11.1

Ref.

3087984

5.15. Driver upgrade in a Linux guest VM with multiple vGPUs might fail

Description

Upgrading the NVIDIA vGPU software graphics driver in a Linux guest VM with multiple vGPUs might fail. This issue occurs if the driver is upgraded by overinstalling the new release of the driver on the current release of the driver while the `nvidia-gridd` service is running in the VM.

Workaround

1. Stop the `nvidia-gridd` service.
2. Try again to upgrade the driver.

Status

Open

Ref.

200633548

5.16. 11.0 Only: Failure to allocate resources causes VM failures or crashes

Description

Failure to allocate resources causes VM failures or crashes. When the error occurs, the error message `NVOS status 0x19` is written to the log file on the hypervisor host. Depending on the resource and the underlying cause of the failure, `VGPU message 52 failed`, `VGPU message 4 failed`, `VGPU message 21 failed`, and `VGPU message 10 failed` might also be written to the log file on the hypervisor host.

Status

Resolved in NVIDIA vGPU software 11.1

Ref.

200626446

5.17. NVIDIA Control Panel fails to start if launched too soon from a VM without licensing information

Description

If NVIDIA licensing information is not configured on the system, any attempt to start **NVIDIA Control Panel** by right-clicking on the desktop within 30 seconds of the VM being started fails.

Workaround

Restart the VM and wait at least 30 seconds before trying to launch **NVIDIA Control Panel**.

Status

Open

Ref.

200623179

5.18. 11.0 Only: Remoting solution session freezes with VGPU message 21 failed and VGPU message 14 failed errors

Description

The remoting solution session sometimes freezes while a window is being resized. For a Windows guest VM, the error message `VGPU message 21 failed` is written to the log file on the hypervisor host. For a Linux guest VM, the error messages `VGPU message 21 failed` and `VGPU message 14 failed` are written to the log file on the hypervisor host.

Workaround

Try resizing the window again.

Status

Resolved in NVIDIA vGPU software 11.1

Ref.

200627445

5.19. On Linux, the frame rate might drop to 1 after several minutes

Description

On Linux, the frame rate might drop to 1 frame per second (FPS) after NVIDIA vGPU software has been running for several minutes. Only some applications are affected, for example, `glxgears`. Other applications, such as Unigine Heaven, are not affected. This behavior occurs because Display Power Management Signaling (DPMS) for the Xorg server is enabled by default and the display is detected to be inactive even when the application is running. When DPMS is enabled, it enables power saving behavior of the display after several minutes of inactivity by setting the frame rate to 1 FPS.

Workaround

1. If necessary, stop the Xorg server.

```
# /etc/init.d/xorg stop
```

2. In a plain text editor, edit the `/etc/X11/xorg.conf` file to set the options to disable DPMS and disable the screen saver.

- a). In the `Monitor` section, set the `DPMS` option to `false`.

```
Option "DPMS" "false"
```

- b). At the end of the file, add a `ServerFlags` section that contains option to disable the screen saver.

```
Section "ServerFlags"
    Option "BlankTime" "0"
EndSection
```

- c). Save your changes to `/etc/X11/xorg.conf` file and quit the editor.

3. Start the Xorg server.

```
# etc/init.d/xorg start
```

Status

Open

Ref.

200605900

5.20. DWM crashes randomly occur in Windows VMs

Description

Desktop Windows Manager (DWM) crashes randomly occur in Windows VMs, causing a blue-screen crash and the bug check `CRITICAL_PROCESS_DIED`. Computer Management shows problems with the primary display device.

Version

This issue affects Windows 10 1809, 1903 and 1909 VMs.

Status

Not an NVIDIA bug

Ref.

2730037

5.21. Publisher not verified warning during Windows 7 driver installation

Description

During installation of the NVIDIA vGPU software graphics driver for Windows on Windows 7, Windows warns that it can't verify the publisher of the driver software. If **Device Manager** is used to install the driver, **Device Manager** warns that the driver is not digitally signed. If you install the driver, error 52 (CM_PROB_UNSIGNED_DRIVER) occurs.

This issue occurs because Microsoft is no longer dual signing WHQL-tested software binary files by using the SHA-1 and SHA-2 hash algorithms. Instead, WHQL-tested software binary files are signed only by using the SHA-2 hash algorithm. All NVIDIA vGPU software graphics drivers for Windows are WHQL tested.

By default, Windows 7 systems cannot recognize signatures that were created by using the SHA-2 hash algorithm. As a result, software binary files that are signed only by using the SHA-2 hash algorithm are considered unsigned.

For more information, see [2019 SHA-2 Code Signing Support requirement for Windows and WSUS](#) on the Microsoft Windows support website.

Version

Windows 7

Workaround

If you experience this issue, install the following updates and restart the VM or host before installing the driver:

- ▶ Servicing stack update (SSU) ([KB4490628](#))
- ▶ SHA-2 update ([KB4474419](#))

Status

Not a bug

5.22. RAPIDS cuDF `merge` fails on NVIDIA vGPU

Description

The `merge` function of the RAPIDS cuDF GPU data frame library fails on NVIDIA vGPU. This function fails because RAPIDS uses the Unified Memory feature of CUDA, which NVIDIA vGPU does not support.

Status

Open

Ref.

2642134

5.23. ECC memory settings for a vGPU cannot be changed by using NVIDIA X Server Settings

Description

The ECC memory settings for a vGPU cannot be changed from a Linux guest VM by using **NVIDIA X Server Settings**. After the ECC memory state has been changed on the **ECC Settings** page and the VM has been rebooted, the ECC memory state remains unchanged.

Workaround

Use the `nvidia-smi` command in the guest VM to enable or disable ECC memory for the vGPU as explained in [Virtual GPU Software User Guide](#).

If the ECC memory state remains unchanged even after you use the `nvidia-smi` command to change it, use the workaround in [Changes to ECC memory settings for a Linux vGPU VM by `nvidia-smi` might be ignored](#).

Status

Open

Ref.

200523086

5.24. Changes to ECC memory settings for a Linux vGPU VM by `nvidia-smi` might be ignored

Description

After the ECC memory state for a Linux vGPU VM has been changed by using the `nvidia-smi` command and the VM has been rebooted, the ECC memory state might remain unchanged.

This issue occurs when multiple NVIDIA configuration files in the system cause the kernel module option for setting the ECC memory state `RMGuestECCState` in `/etc/modprobe.d/nvidia.conf` to be ignored.

When the `nvidia-smi` command is used to enable ECC memory, the file `/etc/modprobe.d/nvidia.conf` is created or updated to set the kernel module option `RMGuestECCState`. Another configuration file in `/etc/modprobe.d/` that contains the keyword `NVreg_RegistryDwordsPerDevice` might cause the kernel module option `RMGuestECCState` to be ignored.

Workaround

This workaround requires administrator privileges.

1. Move the entry containing the keyword `NVreg_RegistryDwordsPerDevice` from the other configuration file to `/etc/modprobe.d/nvidia.conf`.
2. Reboot the VM.

Status

Open

Ref.

200505777

5.25. Vulkan applications crash in Windows 7 guest VMs configured with NVIDIA vGPU

Description

In Windows 7 guest VMs configured with NVIDIA vGPU, applications developed with Vulkan APIs crash or throw errors when they are launched. Vulkan APIs require sparse texture support, but in Windows 7 guest VMs configured with NVIDIA vGPU, sparse textures are not enabled.

In Windows 10 guest VMs configured with NVIDIA vGPU, sparse textures are enabled and applications developed with Vulkan APIs run correctly in these VMs.

Status

Open

Ref.

200381348

5.26. Host core CPU utilization is higher than expected for moderate workloads

Description

When GPU performance is being monitored, host core CPU utilization is higher than expected for moderate workloads. For example, host CPU utilization when only a small number of VMs are running is as high as when several times as many VMs are running.

Workaround

Disable monitoring of the following GPU performance statistics:

- ▶ vGPU engine usage by applications across multiple vGPUs
- ▶ Encoder session statistics
- ▶ Frame buffer capture (FBC) session statistics
- ▶ Statistics gathered by performance counters in guest VMs

Status

Open

Ref.

2414897

5.27. Frame capture while the interactive logon message is displayed returns blank screen

Description

Because of a known limitation with NvFBC, a frame capture while the interactive logon message is displayed returns a blank screen.

An NvFBC session can capture screen updates that occur after the session is created. Before the logon message appears, there is no screen update after the message is shown and, therefore, a black screen is returned instead. If the NvFBC session is created after this update has occurred, NvFBC cannot get a frame to capture.

Workaround

Press **Enter** or wait for the screen to update for NvFBC to capture the frame.

Status

Not a bug

Ref.

2115733

5.28. RDS sessions do not use the GPU with some Microsoft Windows Server releases

Description

When some releases of Windows Server are used as a guest OS, Remote Desktop Services (RDS) sessions do not use the GPU. With these releases, the RDS sessions by default use the Microsoft Basic Render Driver instead of the GPU. This default setting enables 2D DirectX applications such as Microsoft Office to use software rendering, which can be more efficient than using the GPU for rendering. However, as a result, 3D applications that use DirectX are prevented from using the GPU.

Version

- ▶ Windows Server 2019
- ▶ Windows Server 2016
- ▶ Windows Server 2012

Solution

Change the local computer policy to use the hardware graphics adapter for all RDS sessions.

1. Choose **Local Computer Policy > Computer Configuration > Administrative Templates > Windows Components > Remote Desktop Services > Remote Desktop Session Host > Remote Session Environment**.
2. Set the **Use the hardware default graphics adapter for all Remote Desktop Services sessions** option.

5.29. When the scheduling policy is fixed share, GPU utilization is reported as higher than expected

Description

When the scheduling policy is fixed share, GPU engine utilization can be reported as higher than expected for a vGPU.

For example, GPU engine usage for six P40-4Q vGPUs on a Tesla P40 GPU might be reported as follows:

```
[root@localhost:~] nvidia-smi vgpu
Mon Aug 20 10:33:18 2018
```

NVIDIA-SMI 390.42		Driver Version: 390.42	
GPU	Name	Bus-Id	GPU-Util
vGPU ID	Name	VM ID	vGPU-Util
0	Tesla P40	00000000:81:00.0	99%
85109	GRID P40-4Q	85110	win7-xmpl-146048-1
87195	GRID P40-4Q	87196	win7-xmpl-146048-2
88095	GRID P40-4Q	88096	win7-xmpl-146048-3
89170	GRID P40-4Q	89171	win7-xmpl-146048-4
90475	GRID P40-4Q	90476	win7-xmpl-146048-5
93363	GRID P40-4Q	93364	win7-xmpl-146048-6
1	Tesla P40	00000000:85:00.0	0%

The vGPU utilization of vGPU 85109 is reported as 32%. For vGPU 87195, vGPU utilization is reported as 39%. And for 88095, it is reported as 26%. However, the expected vGPU utilization of any vGPU should not exceed approximately 16.7%.

This behavior is a result of the mechanism that is used to measure GPU engine utilization.

Status

Open

Ref.

2227591

5.30. License is not acquired in Windows VMs

Description

When a windows VM configured with a licensed vGPU is started, the VM fails to acquire a license.

Error messages in the following format are written to the NVIDIA service logs:

```
[000000020.860152600 sec] - [Logging.lib] ERROR: [nvGridLicensing.FlexUtility]
353@FlexUtility::LogFneError : Error: Failed to add trusted storage. Server
URL : license-server-url -
[1,7E2,2,1[7000003F,0,9B00A7]]
```

System machine type does not match expected machine type..

Workaround

This workaround requires administrator privileges.

1. Stop the **NVIDIA Display Container LS** service.
2. Delete the contents of the folder %SystemDrive%\Program Files\NVIDIA Corporation\Grid Licensing.
3. Start the **NVIDIA Display Container LS** service.

Status

Closed

Ref.

200407287

5.31. `nvidia-smi` reports that vGPU migration is supported on all hypervisors

Description

The command `nvidia-smi vgpu -m` shows that vGPU migration is supported on all hypervisors, even hypervisors or hypervisor versions that do not support vGPU migration.

Status

Closed

Ref.

200407230

5.32. Hot plugging and unplugging vCPUs causes a blue-screen crash in Windows VMs

Description

Hot plugging or unplugging vCPUs causes a blue-screen crash in Windows VMs that are running NVIDIA vGPU software graphics drivers.

When the blue-screen crash occurs, one of the following error messages may also be seen:

- ▶ `SYSTEM_SERVICE_EXCEPTION(nvlddmkm.sys)`
- ▶ `DRIVER_IRQL_NOT_LESS_OR_EQUAL(nvlddmkm.sys)`

NVIDIA vGPU software graphics drivers do not support hot plugging and unplugging of vCPUs.

Status

Closed

Ref.

2101499

5.33. Luxmark causes a segmentation fault on an unlicensed Linux client

Description

If the Luxmark application is run on a Linux guest VM configured with NVIDIA vGPU that is booted without acquiring a license, a segmentation fault occurs and the application core dumps. The fault occurs when the application cannot allocate a CUDA object on NVIDIA vGPUs where CUDA is disabled. On NVIDIA vGPUs that can support CUDA, CUDA is disabled in unlicensed mode.

Status

Not an NVIDIA bug.

Ref.

200330956

5.34. A segmentation fault in DBus code causes `nvidia-gridd` to exit on Red Hat Enterprise Linux and CentOS

Description

On Red Hat Enterprise Linux 6.8 and 6.9, and CentOS 6.8 and 6.9, a segmentation fault in DBus code causes the `nvidia-gridd` service to exit.

The `nvidia-gridd` service uses DBus for communication with **NVIDIA X Server Settings** to display licensing information through the **Manage License** page. Disabling the GUI for licensing resolves this issue.

To prevent this issue, the GUI for licensing is disabled by default. You might encounter this issue if you have enabled the GUI for licensing and are using Red Hat Enterprise Linux 6.8 or 6.9, or CentOS 6.8 and 6.9.

Version

Red Hat Enterprise Linux 6.8 and 6.9

CentOS 6.8 and 6.9

Status

Open

Ref.

- ▶ 200358191
- ▶ 200319854
- ▶ 1895945

5.35. No Manage License option available in NVIDIA X Server Settings by default

Description

By default, the **Manage License** option is not available in **NVIDIA X Server Settings**. This option is missing because the GUI for licensing on Linux is disabled by default to work around the

issue that is described in [A segmentation fault in DBus code causes nvidia-gridd to exit on Red Hat Enterprise Linux and CentOS](#).

Workaround

This workaround requires `sudo` privileges.



Note: Do **not** use this workaround with Red Hat Enterprise Linux 6.8 and 6.9 or CentOS 6.8 and 6.9. To prevent a segmentation fault in DBus code from causing the `nvidia-gridd` service from exiting, the GUI for licensing must be disabled with these OS versions.

If you are licensing a physical GPU for vCS, you **must** use the configuration file `/etc/nvidia/gridd.conf`.

1. If **NVIDIA X Server Settings** is running, shut it down.
2. If the `/etc/nvidia/gridd.conf` file does not already exist, create it by copying the supplied template file `/etc/nvidia/gridd.conf.template`.
3. As root, edit the `/etc/nvidia/gridd.conf` file to set the `EnableUI` option to `TRUE`.
4. Start the `nvidia-gridd` service.

```
# sudo service nvidia-gridd start
```

When **NVIDIA X Server Settings** is restarted, the **Manage License** option is now available.

Status

Open

5.36. Licenses remain checked out when VMs are forcibly powered off

Description

NVIDIA vGPU software licenses remain checked out on the license server when non-persistent VMs are forcibly powered off.

The NVIDIA service running in a VM returns checked out licenses when the VM is shut down. In environments where non-persistent licensed VMs are not cleanly shut down, licenses on the license server can become exhausted. For example, this issue can occur in automated test environments where VMs are frequently changing and are not guaranteed to be cleanly shut down. The licenses from such VMs remain checked out against their MAC address for seven days before they time out and become available to other VMs.

Resolution

If VMs are routinely being powered off without clean shutdown in your environment, you can avoid this issue by shortening the license borrow period. To shorten the license borrow period, set the `LicenseInterval` configuration setting in your VM image. For details, refer to [Virtual GPU Client Licensing User Guide](#).

Status

Closed

Ref.

1694975

5.37. VM bug checks after the guest VM driver for Windows 10 RS2 is installed

Description

When the VM is rebooted after the guest VM driver for Windows 10 RS2 is installed, the VM bug checks. When Windows boots, it selects one of the standard supported video modes. If Windows is booted directly with a display that is driven by an NVIDIA driver, for example a vGPU on Citrix Hypervisor, a blue screen crash occurs.

This issue occurs when the screen resolution is switched from VGA mode to a resolution that is higher than 1920×1200.

Fix

Download and install [Microsoft Windows Update KB4020102](#) from the Microsoft Update Catalog.

Workaround

If you have applied the fix, ignore this workaround.

Otherwise, you can work around this issue until you are able to apply the fix by not using resolutions higher than 1920×1200.

1. Choose a GPU profile in Citrix XenCenter that does not allow resolutions higher than 1920×1200.
2. Before rebooting the VM, set the display resolution to 1920×1200 or lower.

Status

Not an NVIDIA bug

Ref.

200310861

5.38. GNOME Display Manager (GDM) fails to start on Red Hat Enterprise Linux 7.2 and CentOS 7.0

Description

GDM fails to start on Red Hat Enterprise Linux 7.2 and CentOS 7.0 with the following error:

```
Oh no! Something has gone wrong!
```

Workaround

Permanently enable permissive mode for Security Enhanced Linux (SELinux).

1. As root, edit the `/etc/selinux/config` file to set `SELINUX` to `permissive`.

```
SELINUX=permissive
```

2. Reboot the system.

```
~]# reboot
```

For more information, see [Permissive Mode](#) in *Red Hat Enterprise Linux 7 SELinux User's and Administrator's Guide*.

Status

Not an NVIDIA bug

Ref.

200167868

Notice

This document is provided for information purposes only and shall not be regarded as a warranty of a certain functionality, condition, or quality of a product. NVIDIA Corporation ("NVIDIA") makes no representations or warranties, expressed or implied, as to the accuracy or completeness of the information contained in this document and assumes no responsibility for any errors contained herein. NVIDIA shall have no liability for the consequences or use of such information or for any infringement of patents or other rights of third parties that may result from its use. This document is not a commitment to develop, release, or deliver any Material (defined below), code, or functionality.

NVIDIA reserves the right to make corrections, modifications, enhancements, improvements, and any other changes to this document, at any time without notice.

Customer should obtain the latest relevant information before placing orders and should verify that such information is current and complete.

NVIDIA products are sold subject to the NVIDIA standard terms and conditions of sale supplied at the time of order acknowledgement, unless otherwise agreed in an individual sales agreement signed by authorized representatives of NVIDIA and customer ("Terms of Sale"). NVIDIA hereby expressly objects to applying any customer general terms and conditions with regards to the purchase of the NVIDIA product referenced in this document. No contractual obligations are formed either directly or indirectly by this document.

NVIDIA products are not designed, authorized, or warranted to be suitable for use in medical, military, aircraft, space, or life support equipment, nor in applications where failure or malfunction of the NVIDIA product can reasonably be expected to result in personal injury, death, or property or environmental damage. NVIDIA accepts no liability for inclusion and/or use of NVIDIA products in such equipment or applications and therefore such inclusion and/or use is at customer's own risk.

NVIDIA makes no representation or warranty that products based on this document will be suitable for any specified use. Testing of all parameters of each product is not necessarily performed by NVIDIA. It is customer's sole responsibility to evaluate and determine the applicability of any information contained in this document, ensure the product is suitable and fit for the application planned by customer, and perform the necessary testing for the application in order to avoid a default of the application or the product. Weaknesses in customer's product designs may affect the quality and reliability of the NVIDIA product and may result in additional or different conditions and/or requirements beyond those contained in this document. NVIDIA accepts no liability related to any default, damage, costs, or problem which may be based on or attributable to: (i) the use of the NVIDIA product in any manner that is contrary to this document or (ii) customer product designs.

No license, either expressed or implied, is granted under any NVIDIA patent right, copyright, or other NVIDIA intellectual property right under this document. Information published by NVIDIA regarding third-party products or services does not constitute a license from NVIDIA to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property rights of the third party, or a license from NVIDIA under the patents or other intellectual property rights of NVIDIA.

Reproduction of information in this document is permissible only if approved in advance by NVIDIA in writing, reproduced without alteration and in full compliance with all applicable export laws and regulations, and accompanied by all associated conditions, limitations, and notices.

THIS DOCUMENT AND ALL NVIDIA DESIGN SPECIFICATIONS, REFERENCE BOARDS, FILES, DRAWINGS, DIAGNOSTICS, LISTS, AND OTHER DOCUMENTS (TOGETHER AND SEPARATELY, "MATERIALS") ARE BEING PROVIDED "AS IS." NVIDIA MAKES NO WARRANTIES, EXPRESSED, IMPLIED, STATUTORY, OR OTHERWISE WITH RESPECT TO THE MATERIALS, AND EXPRESSLY DISCLAIMS ALL IMPLIED WARRANTIES OF NONINFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE. TO THE EXTENT NOT PROHIBITED BY LAW, IN NO EVENT WILL NVIDIA BE LIABLE FOR ANY DAMAGES, INCLUDING WITHOUT LIMITATION ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, PUNITIVE, OR CONSEQUENTIAL DAMAGES, HOWEVER CAUSED AND REGARDLESS OF THE THEORY OF LIABILITY, ARISING OUT OF ANY USE OF THIS DOCUMENT, EVEN IF NVIDIA HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES. Notwithstanding any damages that customer might incur for any reason whatsoever, NVIDIA's aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the Terms of Sale for the product.

VESA DisplayPort

DisplayPort and DisplayPort Compliance Logo, DisplayPort Compliance Logo for Dual-mode Sources, and DisplayPort Compliance Logo for Active Cables are trademarks owned by the Video Electronics Standards Association in the United States and other countries.

HDMI

HDMI, the HDMI logo, and High-Definition Multimedia Interface are trademarks or registered trademarks of HDMI Licensing LLC.

OpenCL

OpenCL is a trademark of Apple Inc. used under license to the Khronos Group Inc.

Trademarks

NVIDIA, the NVIDIA logo, NVIDIA GRID, NVIDIA GRID vGPU, NVIDIA Maxwell, NVIDIA Pascal, NVIDIA Turing, NVIDIA Volta, GPUDirect, Quadro, and Tesla are trademarks or registered trademarks of NVIDIA Corporation in the U.S. and other countries. Other company and product names may be trademarks of the respective companies with which they are associated.

Copyright

© 2013-2021 NVIDIA Corporation. All rights reserved.

